

Series 440 Installation and Operating Instructions

1 SAFETY NOTES

Safe and secure operation of the head transmitter can only be guaranteed if the operating instructions and all safety notes contained are understood and followed.

1.1 Correct Use

The unit is a universal, presettable temperature transmitter for resistance thermometer (RTD). The unit is constructed for mounting in a connection head and a field housing. The manufacturer cannot be held responsible for damage caused by misuse of the unit.

1.2 Installation, commissioning and operation

The unit is constructed using the most up-to-date production equipment and complies with the safety requirements of the EU guidelines. If it is installed incorrectly or is misused, certain application dangers can occur. Trained personnel must do installation, wiring, and maintenance of the unit. These personnel must have read and understood these instructions and must follow them to the letter.

2 FUNCTION AND SYSTEM CONSTRUCTION

2.1 Function

Provides electronic monitoring of input signals into an analog output signal in industrial temperature measurement. The head transmitter is mounted in a connection head or separated from the sensor in a field housing. Setting up of the head transmitter is done using PC and configuration software. The configuration kit is required for setting up the head transmitter.

2.2 Measurement system

Transforming the following input signals:

- Resistance thermometers (RTD) (in 2 or 3 wire connection systems)

Fault monitoring of:

- Measurement range override or undercut
- Sensor breakage and short circuit

3 INSTALLATION

3.1 Installation conditions

Ambient temperature: (-40 to 85) °C [-40 to 185] °F

Installation area: Field housing; connection head

Installation angle: No limit

Safety notes: The unit must only be powered by a power supply that operates using an IEC 61010-1 compliant energy limited circuit.


3.2 Installation

- Feed the sensor leadwires through the central hole in the head transmitter
- Position the head transmitter in the connection head
- Feed the installation screws through the slots in the head transmitter.
- Screw the head transmitter into the field housing using a screwdriver while not over tightening.

4 WIRING

4.1 Overview

Terminal layout

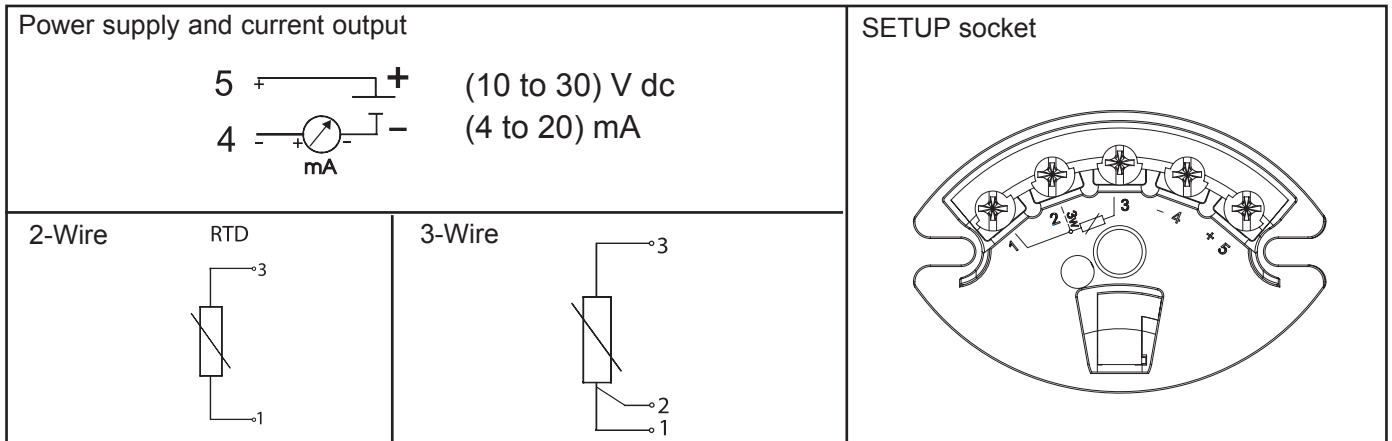

4.2 Measurement unit connection

Attention: Switch off power supply before opening the housing cover. Do not install or connect the unit to mains power. If this is not followed parts of the electronic circuit will be damaged.

- Sensors:
Connect the sensor leads to the respective head transmitter terminals (Terminals 1 to 3) by following the wiring diagram (see figure 4.1).
- Output signal and power supply:
Open the PG cable gland on the head transmitter or field housing. Feed the cable through the opening in the PG cable gland and then connect the cable cores to terminals 4 and 5 according to the wiring diagram (see figure 4.1).
- PC configuration (SETUP socket):
Open the flap on the SETUP socket (Figure 4.1) and connect the SETUP connection cable.

Hint: The screws on the terminals must be screwed tightly. Head transmitter configuration during measurement operation is possible. There is no need to disconnect leads.

Potential leveling

Please take note when installing the head transmitter remotely in a field housing. The screen on the (4 to 20) mA signal output must have the same potential as the screen at the sensor connections. When using earthed thermocouples, screening of the output (4 to 20) mA cable is recommended. In plants with strong electromagnetic fields, screening of all cables with a low ohm connection to the transmitter housing is recommended.

5 OPERATION

5.1 Short form instructions (SETUP)

PRESETTABLE PARAMETERS	
Standard settings	<ul style="list-style-type: none"> • Sensor type • Connection mode (2 or 3 wire connection) • Units (°C or °F) • Measurement range start (depends on sensor) • Measurement range end (depends on sensor)
Expanded settings	<ul style="list-style-type: none"> • Compensation resistance (0 to 20) Ω on 2 wire connection • Fault condition reaction (≤ 3.6 mA or ≥ 21.0 mA) • Output (analog standard/inverse) • Damping (0 to 8) s • Offset (-9.9 to +9.9) °C [-17.8 to +17.8] °F • Measurement point identification/TAG Service functions
Service functions	<ul style="list-style-type: none"> • Simulation (on/off)

For detailed TransComm operating instructions, please read the online documentation contained in the software.

5.2 Communication

The head transmitter must be set up using a PC and configuration kit. The following points must be taken into account if trouble free setting up is to be achieved:

- Configuration software installation.
- Connect the head transmitter to the PC using the connection cable from the configuration kit.

CONFIGURATION SOFTWARE INSTALLATION	
System conditions	<ul style="list-style-type: none"> • IBM PC or compatible computer (minimum Pentium 166 MHz) • Windows 95/98/ME/NT4.0/2000 • 64 MB RAM • Minimum 30 MB free memory on hard drive • CD-ROM drive • Screen resolution 800 x 600 Pixel • Free serial interface
Recommended minimum configuration	<ul style="list-style-type: none"> • Pentium 400 MHz • 128 MB main RAM • 120 MB free hard drive memory • Screen resolution 1024 x 768 Pixel
Installation start	<p>Start Windows</p> <ol style="list-style-type: none"> 1. Place installations-CD in the respective drive 2. Start "Setup.exe" and follow the installation instructions 3. If required, the help/operating manual can be printed once the software has been successfully installed.

Connecting the head transmitter to the PC using the configuration kit connection cable

1. Connect the SETUP connector of the interface cable to the SETUP socket in the head transmitter (see figure 4.1).
2. Connect the RS232C connector to a free serial interface socket on the PC. In order to achieve optimum connection, tighten the RS232C connector screws to the PC.

Note: Configuration of the head transmitter can be done with or without power applied.

6 COMMISSIONING

6.1 Installation check

Monitor all connections making sure they are tight. In order to guarantee fault free operation, the terminal screws must be tight onto the connection cables. The unit is now ready for operation.

6.2 Commissioning

Once the power supply has been connected the head transmitter is operational.

Set up using the PC configuration software

The head transmitter left the factory with a default parameter configuration. If no customer specific configuration was mentioned on the order the default parameter configuration is constructed as follows:

Sensor	Pt100 (RTD)
Connection mode	3-wire
Measurement range and units	(0 to 100) °C

Hint: If a change has been made to the measurement point the head transmitter can be re-configured. In order to re-configure the parameters follow these instructions:

- Install the configuration software and make connection to the PC (see Chapter 5, Operation).
- For detailed operating instructions for the PC configuration software, please read the online documentation contained in the software.

Interactive setting up of the temperature transmitter

Customer specific linearization and sensor matching is done using the TransComm configuration software. The program calculates the linearization coefficients X0 to X4, that need to be entered into the PC configuration software.

6.3 Function check

Measuring the analog (4 to 20) mA output signal or following failure signals:

Underranging	Linear drop from 4.0 to 3.8 mA
Overranging	Linear increase from 20.0 to 20.5 mA
Failure, e.g. sensor breakage; sensor short circuit	≤ 3.6 mA ("low") or ≥ 21 mA ("high"), can be selected The "high" alarm setting can be set between 21.6 mA and 23 mA, thus providing the flexibility needed to meet the requirements of various control systems.

7 MAINTENANCE

The head transmitter is maintenance free.

8 TROUBLESHOOTING

Always start troubleshooting with the checklists below if faults occur after start up or during operation. This takes you directly (via various queries) to the cause of the problem and the appropriate remedial measures. **Note:** Due to its design, the device cannot be repaired. However, it is possible to send the device in for examination.

General errors

Problem	Possible cause	Remedy
Device not reacting	Supply voltage does not match that specified on the nameplate.	Apply the correct voltage.
	No contact between connecting cables and terminals.	Check the contacting of the cables and correct if necessary.
Output current < 3.6 mA	Signal cable is wired incorrectly.	Check wiring.
	Electronics are defective.	Replace the device.

Application errors for RTD sensor connection

Problem	Possible Cause	Remedy
Measured value is incorrect/ inaccurate	Incorrect sensor orientation.	Install the sensor correctly.
	Heat conducted by sensor.	Observe the face-to-face length of the sensor.
	Device programming is incorrect (number of wires).	Change the Connection type device.
	Device programming is incorrect (scaling).	Change scaling.
	Incorrect RTD configured	Change the Sensor type device function.
	Sensor connection.	Check that the sensor is connected correctly.
	The cable resistance of the sensor (2-wire) was not compensated.	Compensate the cable resistance.
	Offset incorrectly set.	Check offset.
Failure current (≤ 3.6 mA or ≥ 21 mA)	Faulty sensor.	Check the sensor.
	RTD connected incorrectly	Connect the connecting cables correctly (terminal diagram).
	Incorrect device programming (e.g. number of wires).	Change the Connection type device function.
	Incorrect programming	Incorrect sensor type set in the Sensor type device function. Set the correct sensor type.